


Pronem Midi Duct Type

Temperature & Relative Humidity Transmitter

Pronem midi is provides to measure temperature and relative humidity and converts the values standart analog or digital signals for send to another system.



Connection Diagram

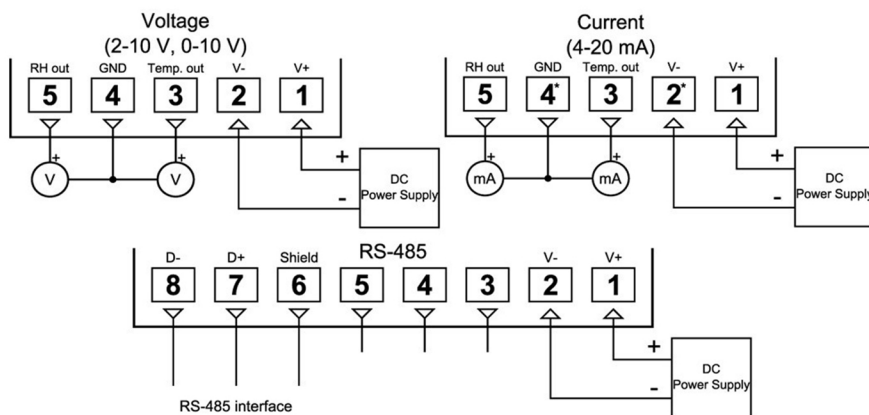

Features	Descriptions
Measuring range (RH)	0...100 %RH
Measuring range (T)	-20...+80 °C
Accuracy (RH)	+/- 2 %RH (Typ) at 23 °C
Accuracy (T)	+/- 0.3 °C (Typ) at 23 °C
Stability (RH)	<0.5 %RH/year (Typ)
Stability (T)	<0.04 °C /year (Typ)
Analogue Out. Sign. Accuracy (Voltage)	+/- % 0.1
Analogue Out. Sign. Accuracy (Current)	+/- %0.5
Working Conditions	
Operating Temperature	-40°C...+85°C
Height	Up to 2000 m.



PT MULTI MAKMUR TEKNIKATAMA

Phone: +62 21 54350091 | +62 21 54350092 | +62 21 54350181

Mobile WA: +62 878 6314 1371 | Fax: +62 21 54350182

Email: admin@multimakmur.co.id | Website: www.multimakmur.co.id





Pronem Midi Wall Type

Temperature & Relative Humidity Transmitter

Pronem midi provides to measure temperature and relative humidity and converts the values standard analog or digital signals for send to another system.

Connection Diagram

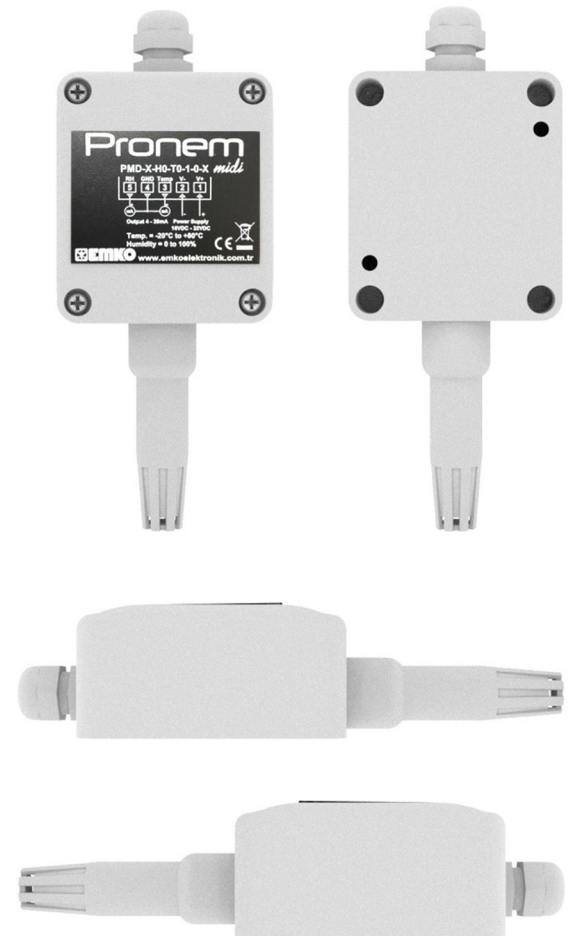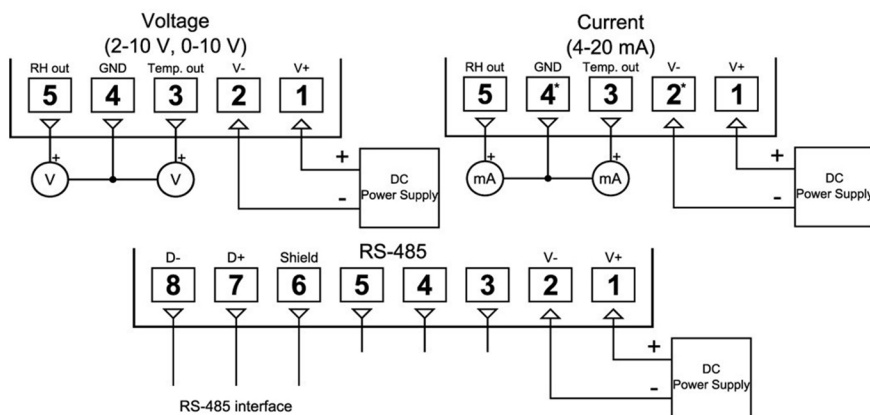

Features	Descriptions
Measuring range (RH)	0...100 %RH
Measuring range (T)	-20...+80 °C
Accuracy (RH)	+/- 2 %RH (Typ) at 23 °C
Accuracy (T)	+/- 0.3 °C (Typ) at 23 °C
Stability (RH)	<0.5 %RH/year (Typ)
Stability (T)	<0.04 °C /year (Typ)
Analogue Out. Sign. Accuracy (Voltage)	+/- % 0.1
Analogue Out. Sign. Accuracy (Current)	+/- %0.5
Working Conditions	
Operating Temperature	-40°C...+85°C
Height	Up to 2000 m.



PT MULTI MAKMUR TEKNIKATAMA

Phone: +62 21 54350091 | +62 21 54350092 | +62 21 54350181

Mobile WA: +62 878 6314 1371 | Fax: +62 21 54350182

Email: admin@multimakmur.co.id | Website: www.multimakmur.co.id

